

HARTFORD, CONNECTICUT

AL-189 (FAA)



LOC I-HFD	APP CRS	Rwy Idg	4008
109.7	002°	TDZE	18
		Apr Elev	19

LDA RWY 2

HARTFORD-BRAINARD (HFD)

MISSED APPROACH: Climbing right turn to 2500 via heading 060° and PUT VOR/DME R-265 to RAMBO Int and hold.

ATIS ★ 126.45	BRADLEY APP CON 127.8 359.0	BRAINARD TOWER ★ 119.6 (CTAF) ● 248.2	GND CON 121.6	UNICOM 122.95
------------------	--------------------------------	--	------------------	------------------

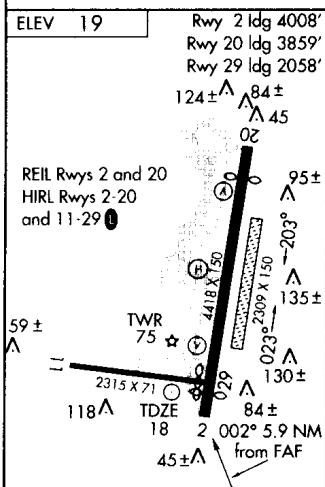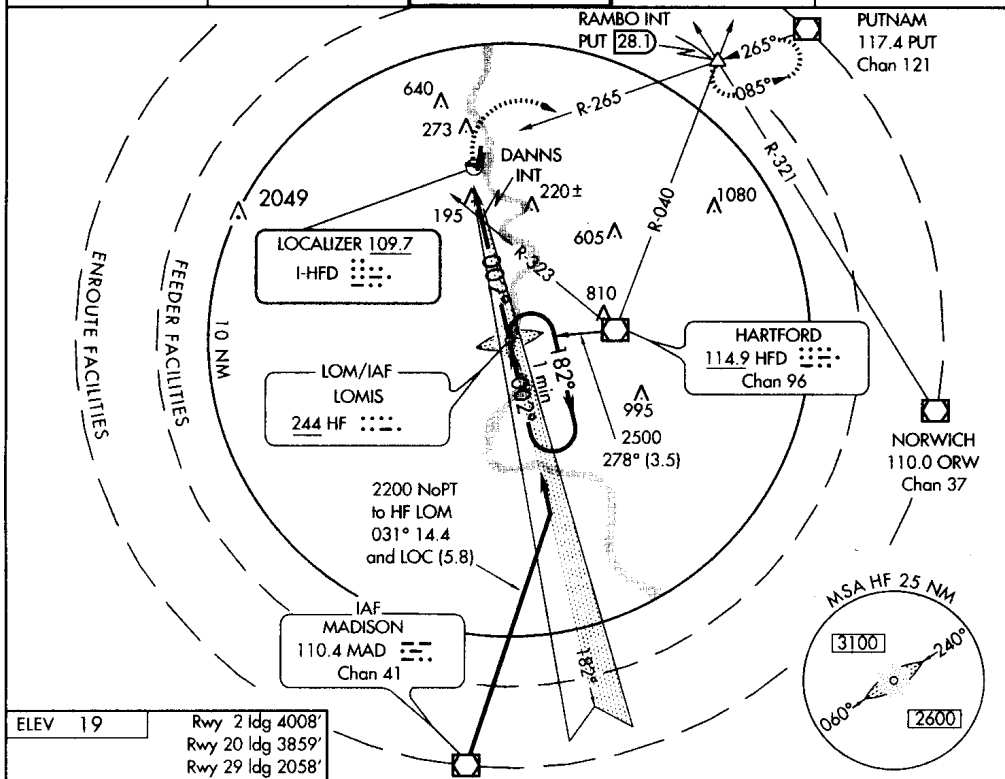

FAF to MAP 5.4 NM					
Knots	60	90	120	150	180
Min:Sec	5:24	3:36	2:42	2:10	1:48

HARTFORD, CONNECTICUT
Amdt 1D 01305

2500 PUT R-265 117.4		RAMBO △		LOM One Minute Holding Pattern	
HDG 060°		DANNS INT 002°		182° 2500	
640		2200		VGSI and descent angles not coincident.	
0.5		1.5 NM		3.9 NM	
CATEGORY	A	B	C	D	
S-2	640-1	622 (700-1)	640-1 3/4 622 (700-1 3/4)	640-2 622 (700-2)	
CIRCLING	640-1	621 (700-1)	940-2 3/4 921 (1000-2 3/4)	1000-3 981 (1000-3)	
DANNS INT MINIMUMS					
S-2	400-1 382 (400-1)			400-1 1/4 382 (400-1 1/4)	
CIRCLING	580-1 561 (600-1)	600-1 581 (600-1)	940-2 3/4 921 (1000-2 3/4)	1000-3 981 (1000-3)	

41°44'N-72°39'W

HARTFORD-BRAINARD (HFD)
LDA RWY 2

NE-1, 13 JUN 2002

NE-1, 13 JUN 2002